


480LF Series Self-Draining Frost-Proof Wall Hydrants

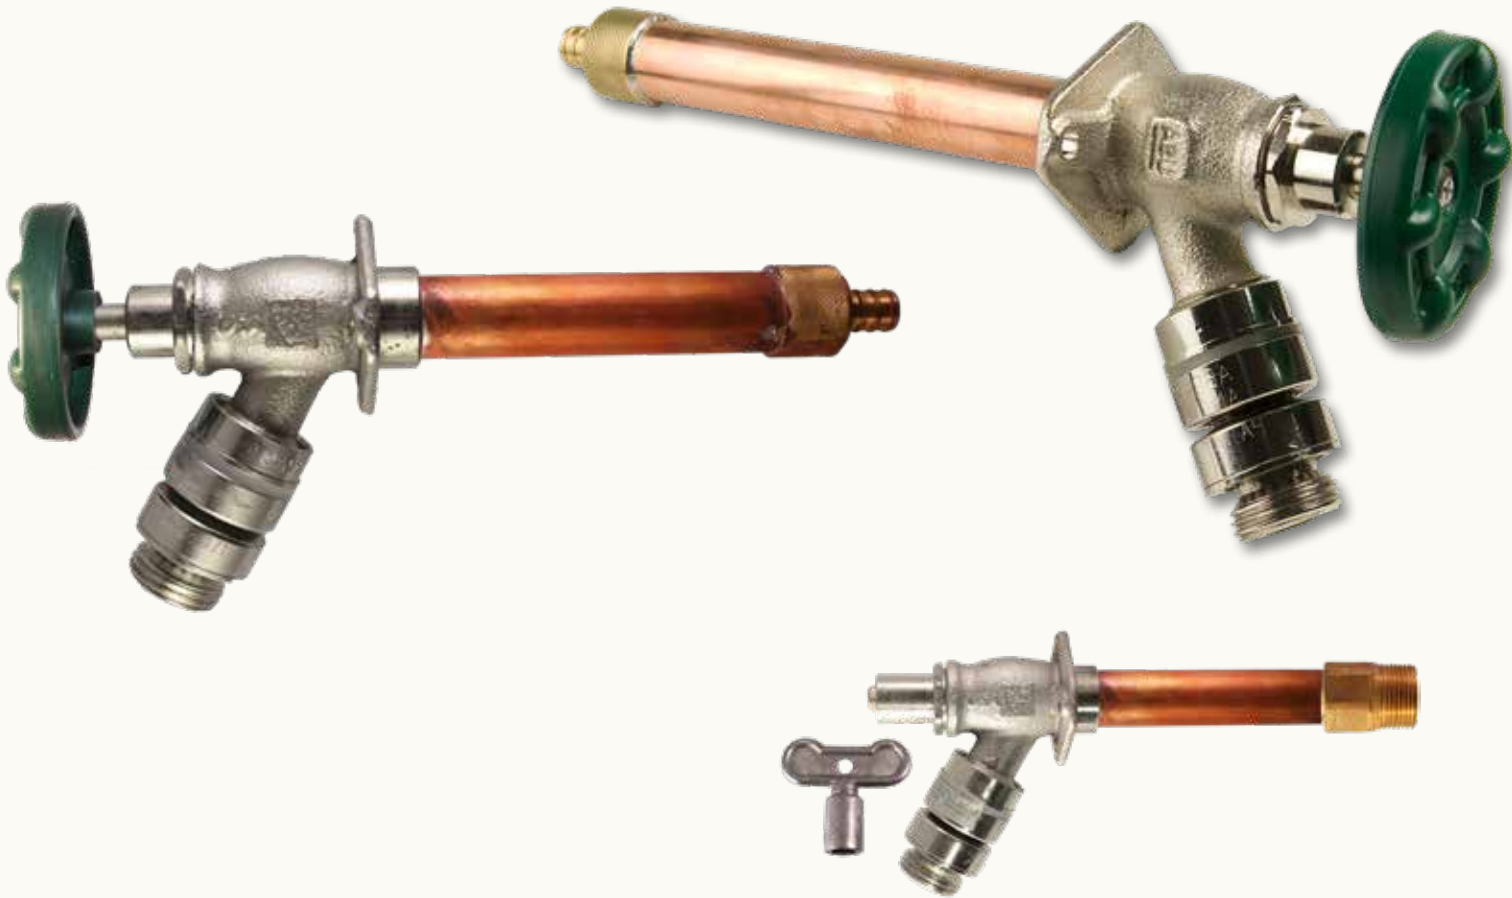

Self-Draining Frost-Proof Wall Hydrants with an integral self-draining vacuum breaker

Features & Benefits

- Heavy duty lead-free bronze construction
- Certified to NSF/ANSI 372 ; UPC listed
- Integral self-draining vacuum breaker that provides protection against backflow and relieves back pressure
- QuickTurn® style operation: easy on-off operation without letting go of the handle
- Wall flange with built-in offset to allow water drainage upon shut-off
- Maximum pressure: 125 PSI
- Maximum temperature: 140° F
- 3-year limited warranty
- Available in 2, 4, 6, 8, 10, 12 & 14 inch lengths
- Available in loose-key and QuickTurn® models







480LF Series Self-Draining
Frost-Proof Wall Hydrants

Base Model & Options

482 Series- 1/2" Uponor PEX A Inlet	485 Series- 1/2" FIP 3/4" MIP Inlets	486 Series- 1/2" MIP & Sweat Inlets	488 Series- 3/4" MIP & Sweat Inlets	489 Series- 1/2" PEX Inlet	Loose Key Option
# 482-xxQTLF 1/2" Uponor - PEX A Inlet	# 485-xxQTLF 1/2" FIP ID 3/4" MIP OD Inlet	# 486-xxQTLF 1/2" Copper Sweat ID 1/2" MIP OD Inlet	# 488-xxQTLF 3/4" Copper Sweat ID 3/4" MIP OD Inlet	# 489-xxQTLF 1/2" Crimp PEX (ASTM F1807) Inlet	# 48-xxLKLf Removable loose key lock-shield

Repair & Replacement Parts

Stem Rebuild Kit # PK1000 Includes seat washer (1), seat washer screw (1), nylon bonnet washer (1), & handle (1) screw	Replacement Oval Handle & Screw # PK1295 Replacement rubber-coated green oval handle (die-cast aluminum) & stainless steel self-tapping screw
Self-Draining Vacuum Breaker # PK1390 Replacement self-draining vacuum break, chrome-plated - 1-1/16" Fine thread inlet	Complete Stem Assembly # PK80xx * 04, 06, 08, 10, 12, 14 - inch stem assembly (see below for total stem length)

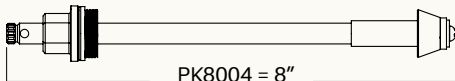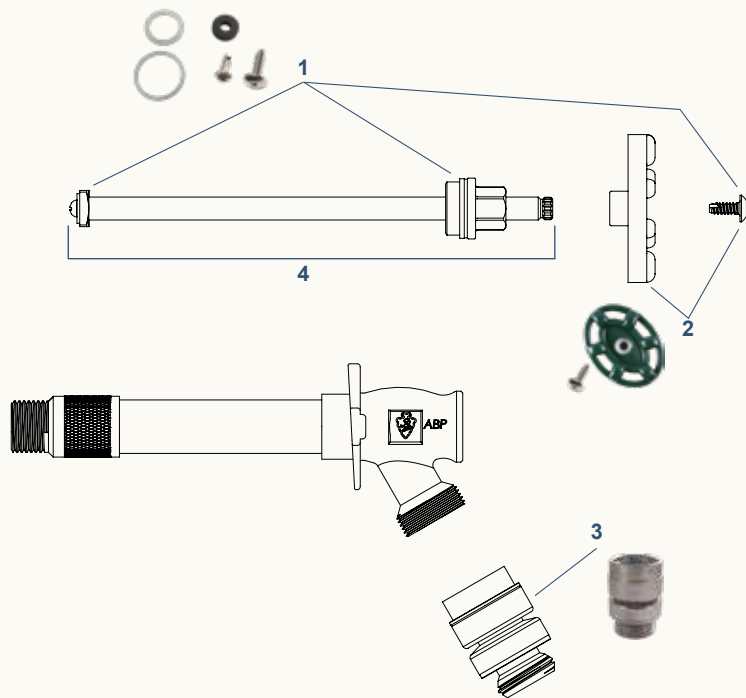

- PK8004 = 8"
- PK8006 = 10"
- PK8008 = 12"
- PK8010 = 14"
- PK8012 = 16"
- PK8014 = 18"

WARNING: Frost-Proof wall hydrants must be installed with a downward tilt toward the hose thread outlet AND the hose or other devices must be removed in cold and freezing weather. Failure to properly winterize a frost-proof wall hydrant can result in damage caused by freezing water and is not covered under warranty. For more information please visit our website at www.arrowheadbrass.com



WARNING: This product can expose you to chemicals including lead, which is known to the State of California to cause, cancer and reproductive harm. For more information, go to www.P65Warnings.ca.gov